

**APPLICATION: 1992-94 FORD PRODUCTS, MAZDA
PROBE, MX3, 626 & MX6.
With 1.8L, & 2.5L.**

IMPORTANT DIAGNOSTIC INFORMATION.

The above noted application has two crankshaft position sensors. One is located in the distributor assembly and the other is located on the right (passenger) side of the engine by the crankshaft pulley. A common diagnostic error is the replacement of the distributor assembly, when in fact the failure is related to the engine mounted crankshaft sensor.

Interpretation of the diagnostic trouble codes' noted below will help determine the actual part requiring replacement:

TROUBLE CODE NO. 2 (Crankshaft Position Sensor-*Engine Mounted*)

TROUBLE CODE NO. 3 (Crankshaft Position Sensor-*Distributor Mounted*)

TROUBLE CODE NO. 4 (Crankshaft Position Sensor-*Distributor Mounted*)