




OPERATOR'S MANUAL

CORDLESS BEVELLING MACHINE

BM-6 CORDLESS

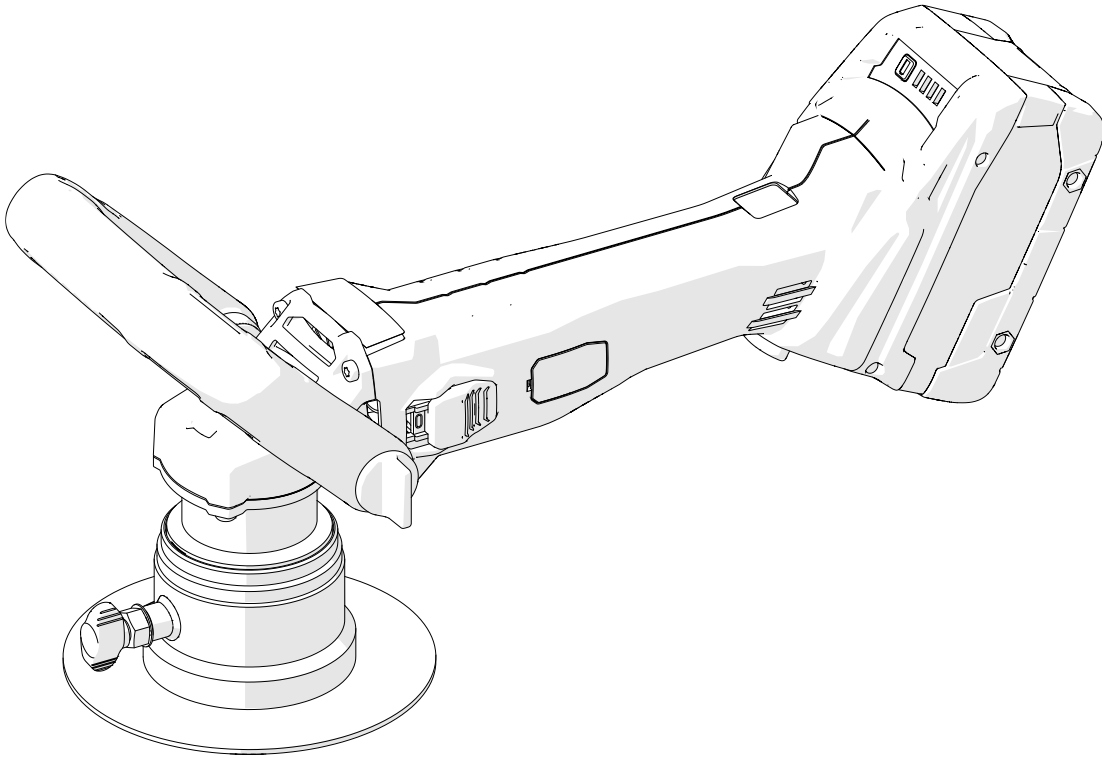

PART NO: WA-BM6-18V

Contents

1. GENERAL INFORMATION.....	3
1.1. Application.....	3
1.2. Technical data.....	3
1.3. Equipment included.....	4
1.4. Dimensions.....	5
1.5. Design.....	6
2. SAFETY PRECAUTIONS.....	7
3. SYMBOLS.....	9
4. STARTUP AND OPERATION.....	10
4.1. Installing and removing the cutting inserts.....	10
4.2. Installing and removing the milling head.....	12
4.3. Checking the battery charge level.....	14
4.4. Installing and removing the battery.....	14
4.5. Handle adjustment.....	15
4.6. Adjusting the bevel width.....	15
4.7. Adjusting the guide for edge curving.....	16
4.8. Adjusting the head roller.....	16
4.9. Operation.....	18
4.10. Replacing the brushes.....	21
5. ACCESSORIES.....	22
5.1. Radius insert positioner.....	22
5.2. Guide sticker.....	23
5.3. Milling tools.....	23
6. PARTS LIST.....	24

LIMITED WARRANTY

Industrial Tool & Machinery Sales (hereinafter referred to as ITMS) will, within 2 years from the original date of purchase, repair or replace any goods found to be defective in materials or workmanship. This warranty is void if the item has been damaged by accident, neglect, improper service or other causes not arising out of defects in materials or workmanship. This warranty does not apply to machines and/or components which have been altered, changed, or modified in any way, or subjected to overloading or use beyond recommended capacities and specifications. Worn componentry due to normal wear and tear is not a warranty claim. Goods returned defective shall be returned prepaid freight to ITMS or agreed repair agent, which shall be the buyer's sole and exclusive remedy for defective goods. ITMS accepts no additional liability pursuant to this guarantee for the costs of travelling or transportation of the product or parts to and from ITMS or the service agent or dealer, such costs are not included in this warranty.

Our goods come with guarantees which cannot be excluded under the Australian Consumer Law. You are entitled to replacement or refund for a major failure and to compensation for other reasonably foreseeable loss or damage. You are also entitled to have the goods repaired or replaced if the goods fail to be of acceptable quality and the failure does not amount to a major failure.

THE MANUFACTURER RESERVES THE RIGHT TO MAKE IMPROVEMENTS AND MODIFICATIONS TO DESIGN WITHOUT PRIOR NOTICE.

PRODUCTS IMPORTED AND DISTRIBUTED NATIONALLY BY:
INDUSTRIAL TOOL & MACHINERY SALES

11 EASTERN SERVICE ROAD, STAPYLTON, QLD, 4207
T: 07 3287 1114 E:sales@itmttools.com.au W: www.itmttools.com.au

1. GENERAL INFORMATION

1.1. Application

The BM-6 is a beveling machine designed to bevel plates and pipes made of steel or aluminum alloys.


Depending on used milling head, the machine allows you to bevel at the angle of 30° or 45°. The minimum workpiece thickness is 4 mm (5/32"). The maximum bevel width is 6 mm (15/64"). The included milling head allows you to bevel at the angle of 45°. The curving inserts allow you to bevel with a radius of 2, 3, 4, or 5 mm (0.08, 0.12, 0.16, or 0.20"). The minimum diameter of a hole to be machined is 40 mm (1 9/16").

The sticker protects aluminum workpieces from scratches.

The machine is designed for use by a professional operator only.


1.2. Technical data

Voltage	18 V DC
Power	900 W
Rotational speed without load	7800 rpm
Protection level	IP 20
Protection class	I
Maximum bevel width (<i>b</i>)	6 mm (15/64", Fig. 1)
Bevel angle (β , depends on the milling head)	30° (option), 45° (Fig. 1)
Minimum workpiece thickness	4 mm (5/32")
Minimum hole diameter	40 mm (1 9/16")
Edge radius	2 mm, 3 mm, 4 mm, 5 mm (0.08, 0.12, 0.16, 0.20") (Fig. 1)
Noise level	More than 70 dB
Vibration level	Machine harmful for health. Take periodic breaks during work.
Required ambient temperature	0-40°C (34-104°F)
Weight	4.7 kg (10.36 lbs)

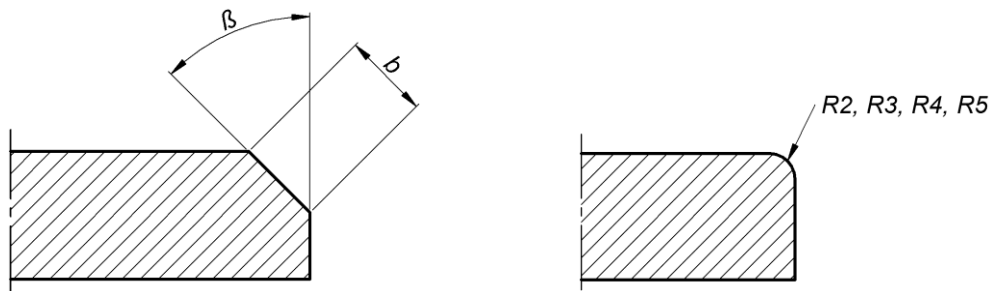

Rys. 1. Bevel dimensions


1.3. Equipment included

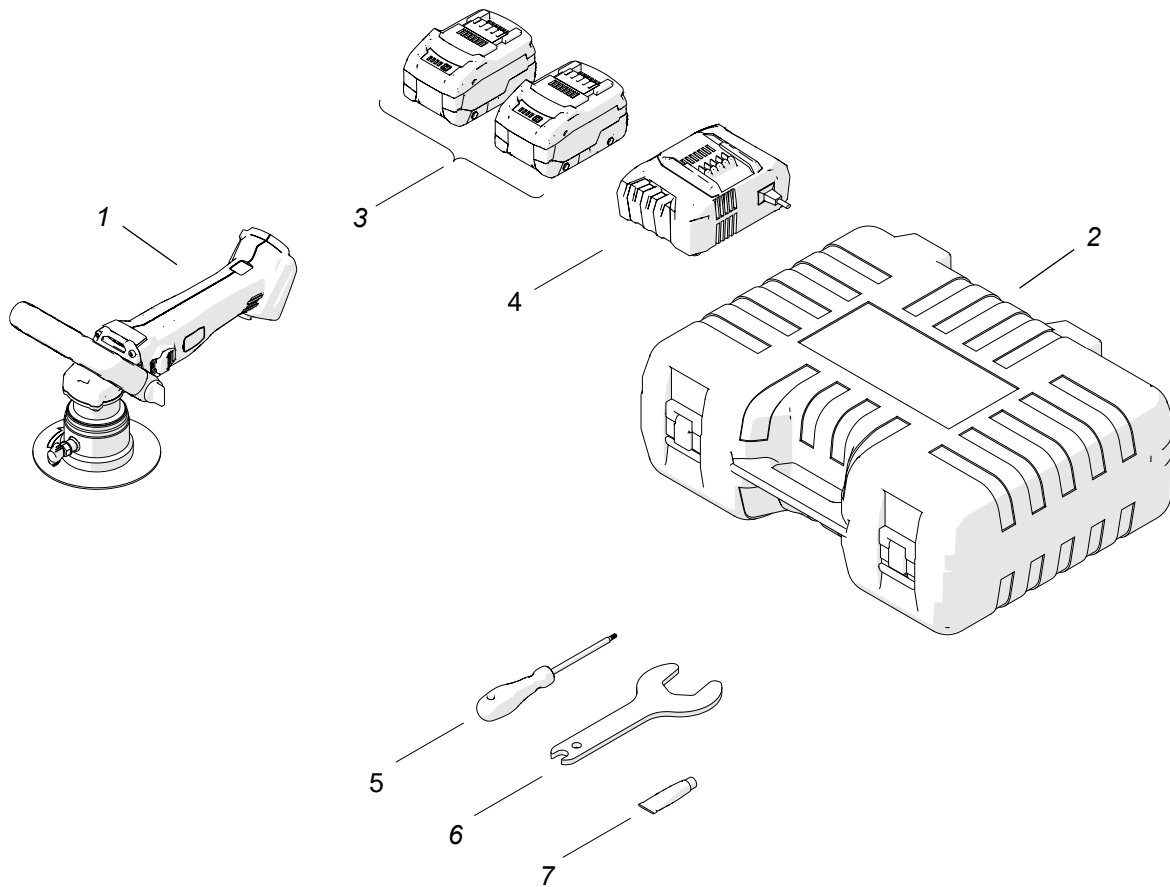



1	Beveling machine (includes 45° milling head with Ø35 mm roller, without cutting inserts)	1 unit
2	Plastic box	1 unit
3	Batteries 18 V LiHD 5.5 Ah *	2 units
4	Battery charger ASC 145 *	1 unit
5	T15 torx screwdriver	1 unit
6	Special wrench	1 unit
7	Grease for mounting screws (5 g, 0.17 oz)	1 unit
-	Operator's Manual	1 unit

*) optional elements

1.4. Dimensions

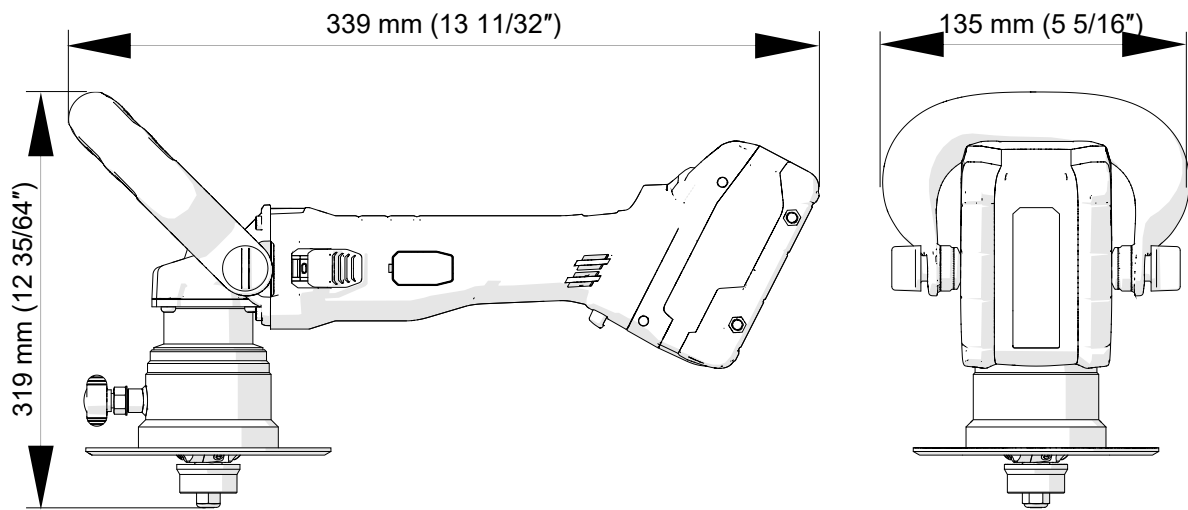

1.5. Design

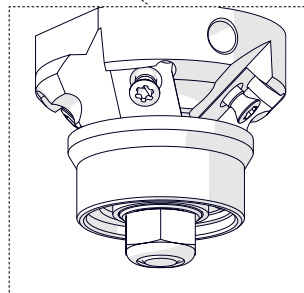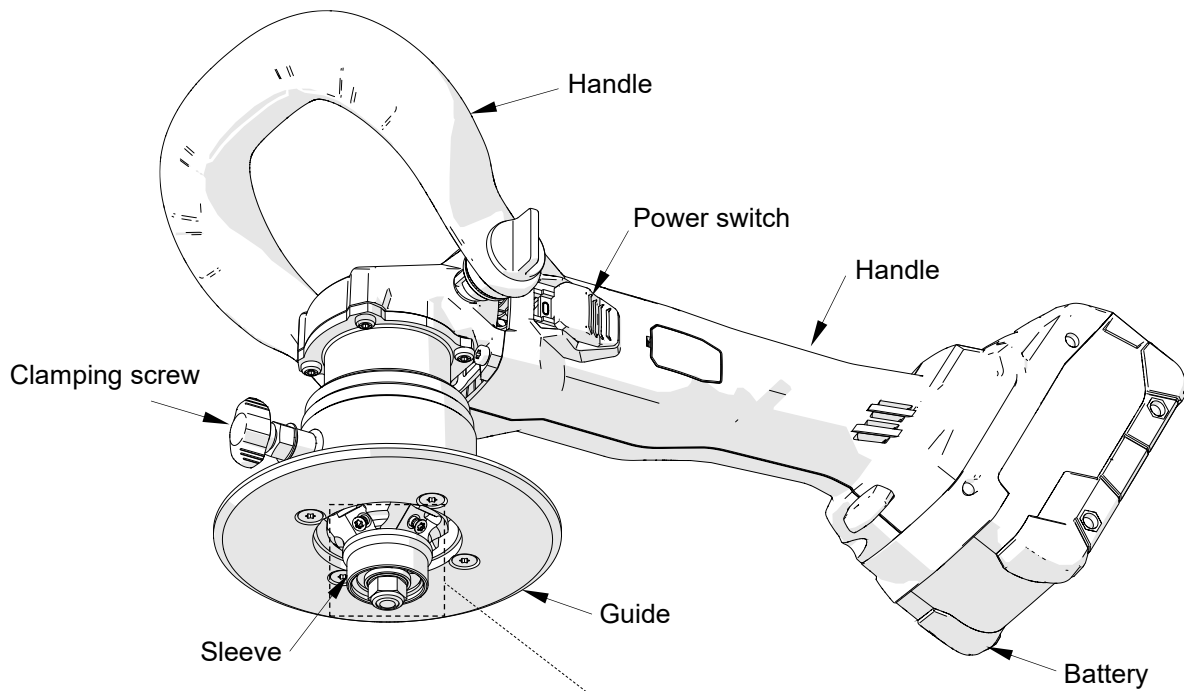

45° milling head with Ø35 mm roller

2. SAFETY PRECAUTIONS

1. Before use, read this Operator's Manual and complete a training in occupational health and safety.
2. Use only in applications specified in this Operator's Manual.
3. Make sure that the machine has all parts and they are genuine and not damaged.
4. Make sure that the specifications of the power source are the same as those specified on the rating plate.
5. Keep untrained persons away from the machine.
6. Before each use, ensure the correct condition of the machine, power source, control parts, and tools.
7. Before each use, make sure that no part is cracked or loose. Make sure to maintain correct conditions that can have an effect on the operation of the machine.
8. Keep the machine dry. Do not expose the machine to rain, snow, or frost.
9. Keep the work area well-lit, clean, and free of obstacles.
10. Do not use near flammable materials, or in explosive environments.
11. Use only tools specified in this Operator's Manual.
12. Do not use tools that are dull or damaged.
13. Make sure that the cutting inserts and the milling head are installed correctly. Remove wrenches from the work area before you connect the machine to the power source.
14. Do not use the machine with the milling head pointing up.
15. If the cutting edge of an insert is worn, turn all inserts by 90°. If all cutting edges are worn, replace all inserts with new ones specified in this Operator's Manual.
16. Use eye and ear protection, non-skid footwear, and protective clothing. The clothing must not be loose.
17. Do not touch chips or moving parts. Do not let anything catch in moving parts.
18. After use, clean the machine and the milling head with a dry cotton cloth and no chemical agents. Do not remove chips with bare hands.
19. Maintain the machine and install/remove parts and tools only after you unplug the machine from the power source.
20. Repair only in a service center appointed by the seller.
21. If the machine falls, is wet, or has any damage, stop the work and immediately send the machine to the service center for check and repair.

22. If you are not going to use the machine, remove it from the work area and keep it in a safe and dry place.
23. If you are not going to use the machine for an extended period, put anti-corrosion material on the steel parts.

3. SYMBOLS

Before using the machine, familiarize yourself with the following symbols (tab. 1).



Wear eye protection



Wear ear protection



Use protective gloves



Read the Operator's Manual


Tab. 1. Explanation of symbols

4. STARTUP AND OPERATION

4.1. Installing and removing the cutting inserts


Disconnect the battery. Loosen the screw (1) and turn the sleeve (2) to lower it as far as possible and get access to the milling head. Use the special wrench (3) to loosen the roller and use the screwdriver (4) to remove the inserts. Clean the sockets.

To change the cutting edge, remove the inserts and turn them by 90°. Press the inserts towards the sockets and tighten them. If all cutting edges are worn, replace all inserts with new ones. Make sure that the whole bottom of the insert touches the socket (5).

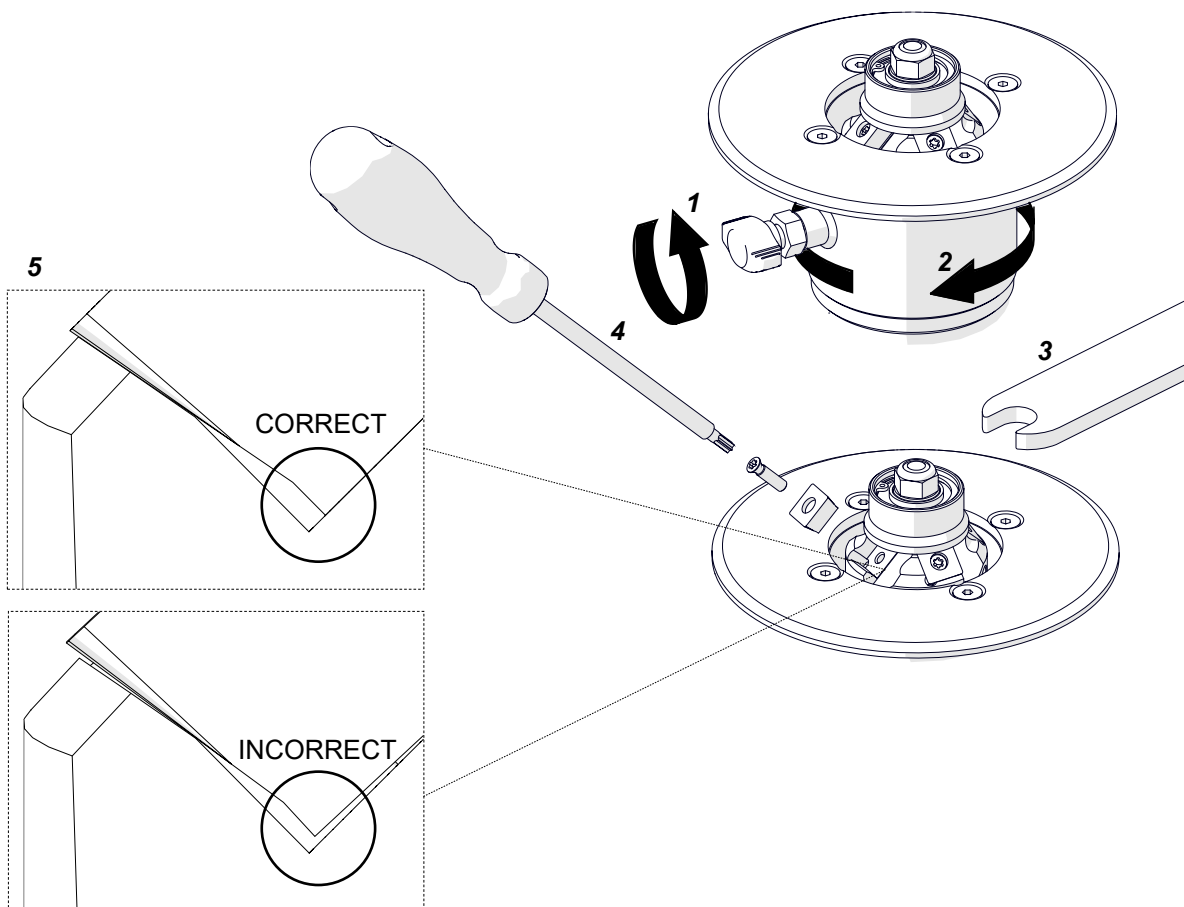


Clean the threads of the mounting screws for inserts every week and put the supplied grease on the threads.

Pay attention during the installation of the cutting inserts for beveling that the head is assembled as shown below: nut (1), round washer (2), special washer (3), roller with bearing and Seeger ring (4). Special washer (3) must be positioned according to the drawing.

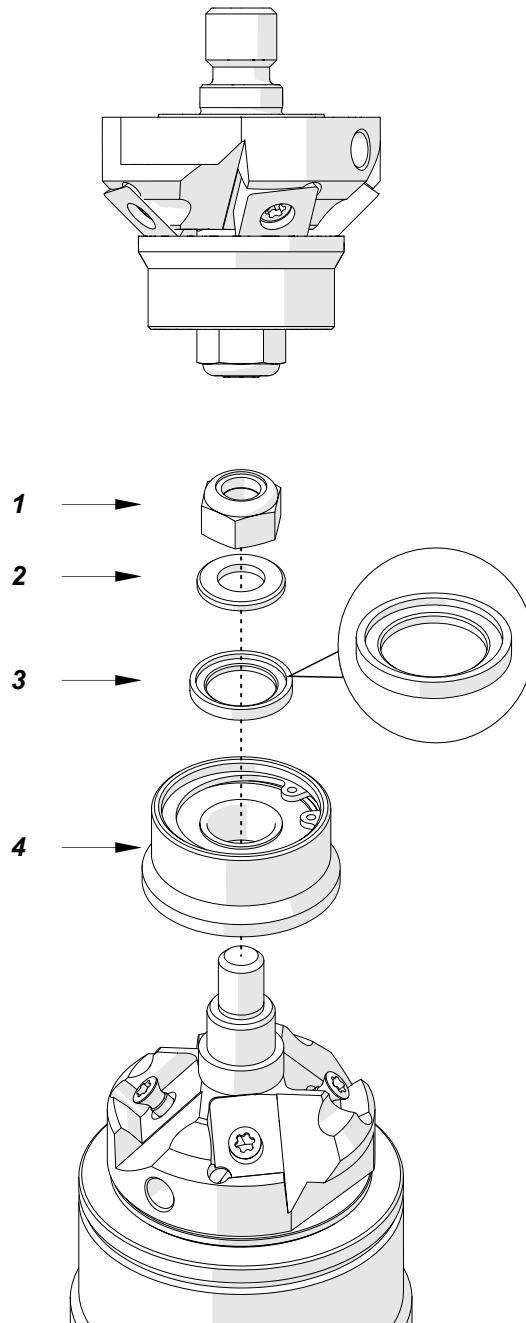


4.2. Installing and removing the milling head

Disconnect the battery. To remove the milling head, continue in the sequence that follows.

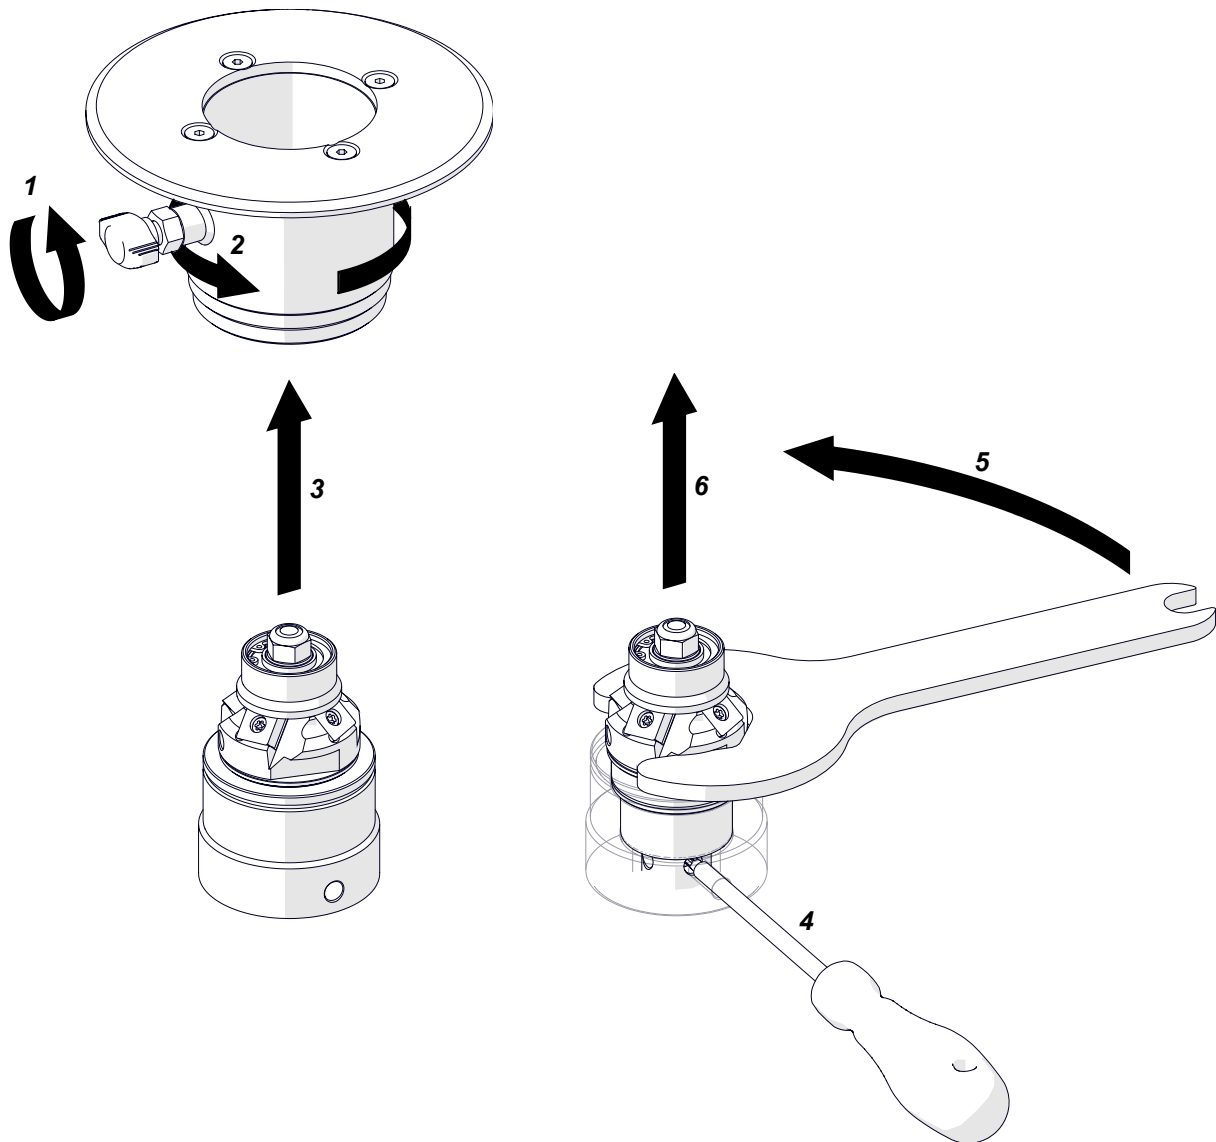

To install the milling head, continue in the sequence that follows.

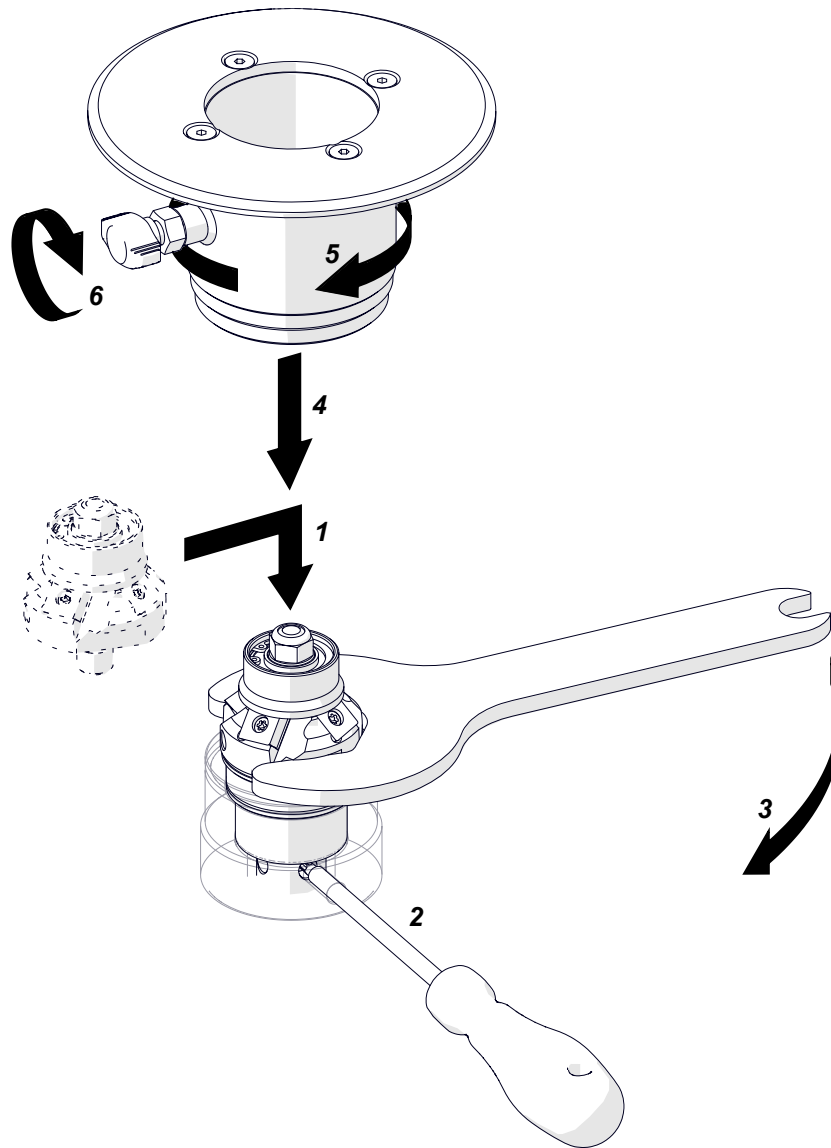

4.3. Checking the battery charge level


Charge the battery before the first use.

To check the charge level, press the charge status button. If only one LED flashes green, charge the battery.

Do not charge fully charged battery.




Before charging the battery, read the charger manual.

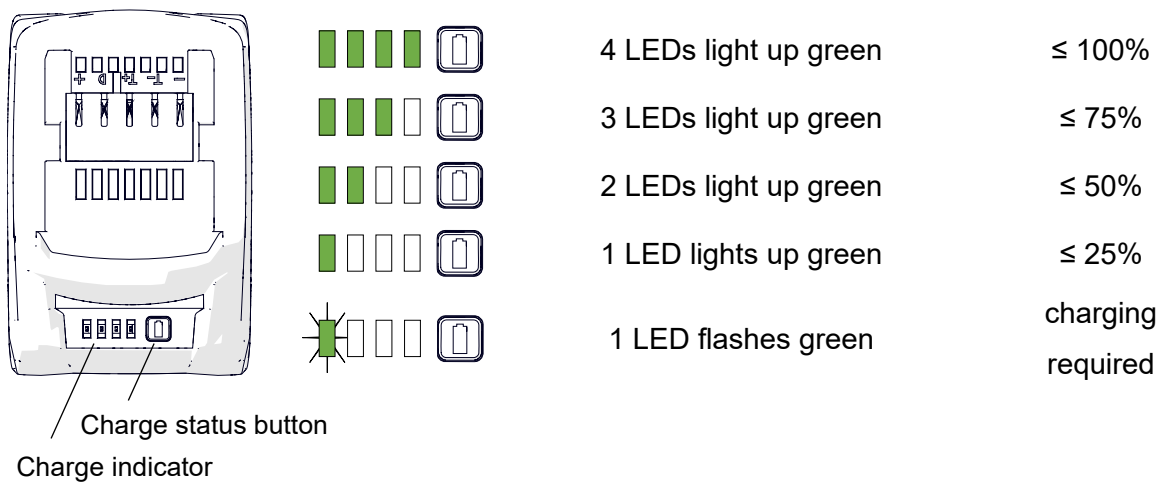


4.4. Installing and removing the battery

Slide the battery (1) in until it locks into place. Press and hold the battery lock (2) to remove the battery (3).

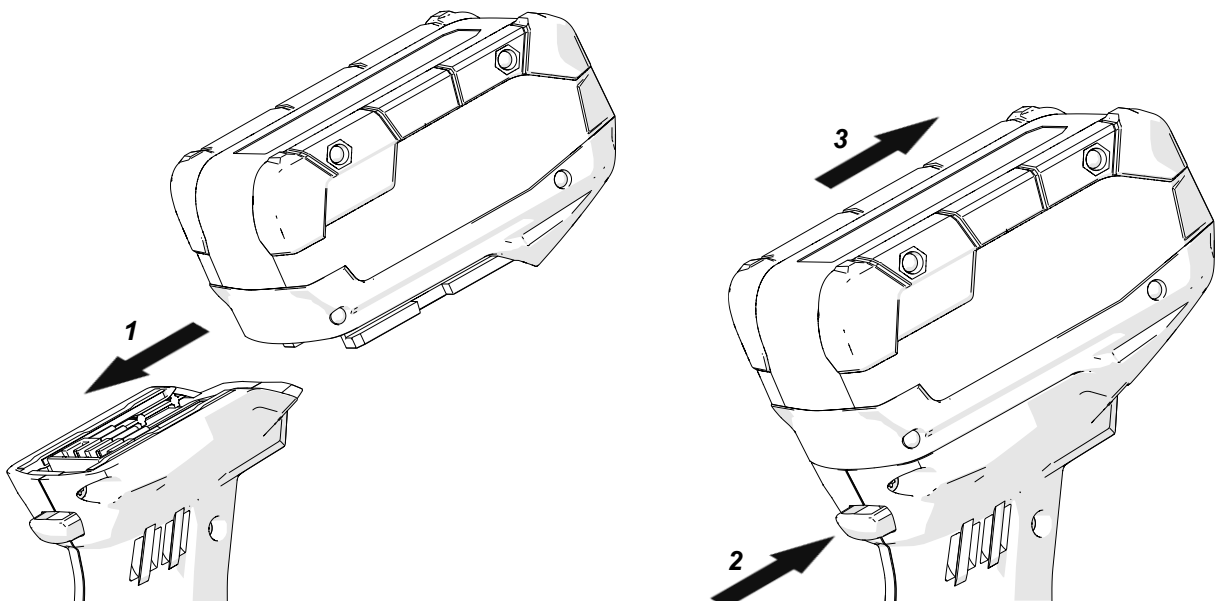


4.5. Handle adjustment

The beveling machine handle may be adjusted so the operator may adapt it to their needs. To adjust, loosen the nuts (1) on both on both sides of the machine. Perform adjustment and tighten the loosened elements.

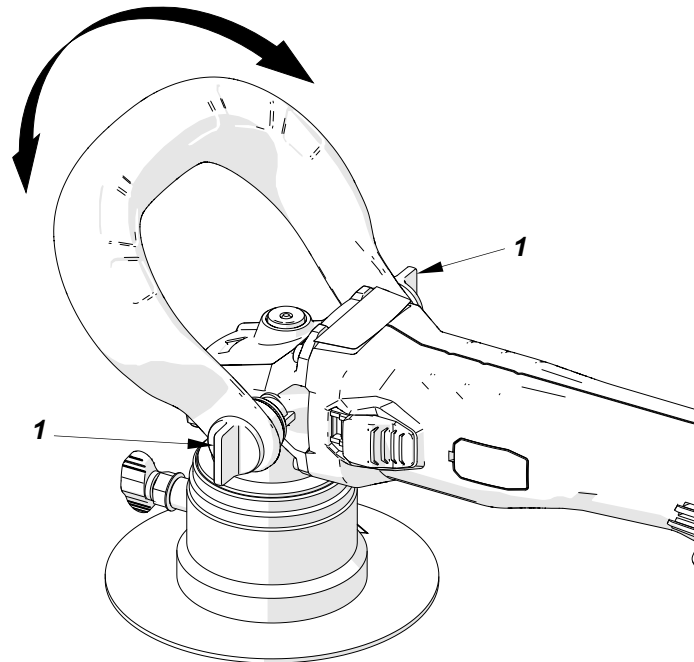


4.6. Adjusting the bevel width

Loosen the screw (1) and rotate the sleeve (2) so that the scale (3) shows the required bevel width. Tighten the screw.

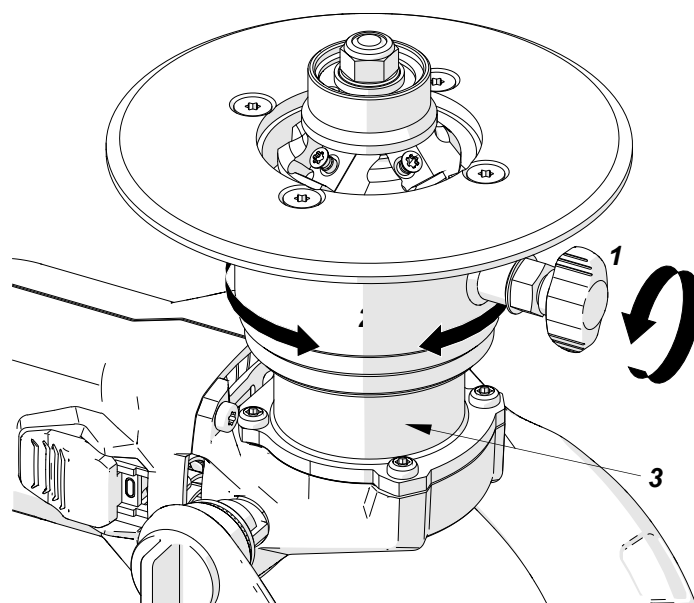

4.7. Adjusting the guide for edge curving


Loosen the clamping screw and turn the sleeve to align the surface (1) with the end of the cutting edge (2). You can also use an optional radius insert positioner to set the guide correctly. Tighten the screw. Bevel a test edge and if necessary adjust the position of the guide again.

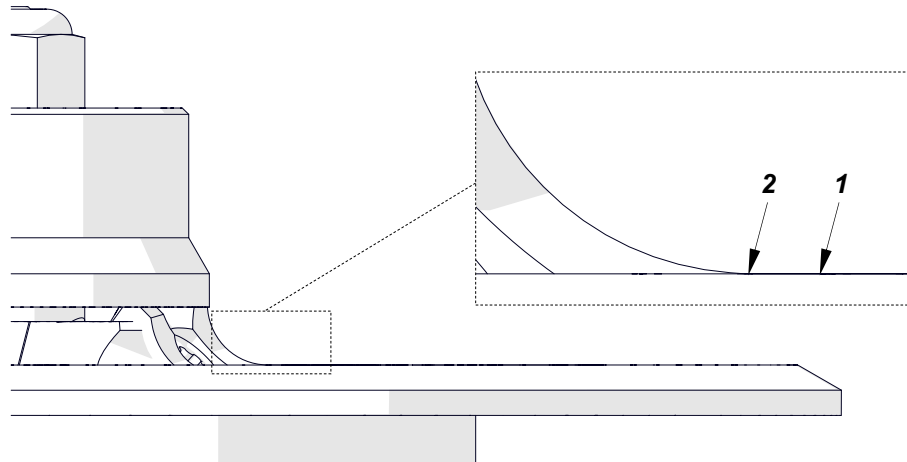


4.8. Adjusting the head roller

During operation with inserts for edge curving R5 check if the inserts do not rub against the head roller after installation. In such case move the roller as described below. Moving the roller consists in changing the position of the special washer.


Position the machine with head up. Remove the sleeve and guide. Use special flat wrench (1) to lock the head rotation. Use flat wrench 13 mm (2) to unscrew the nut (3).

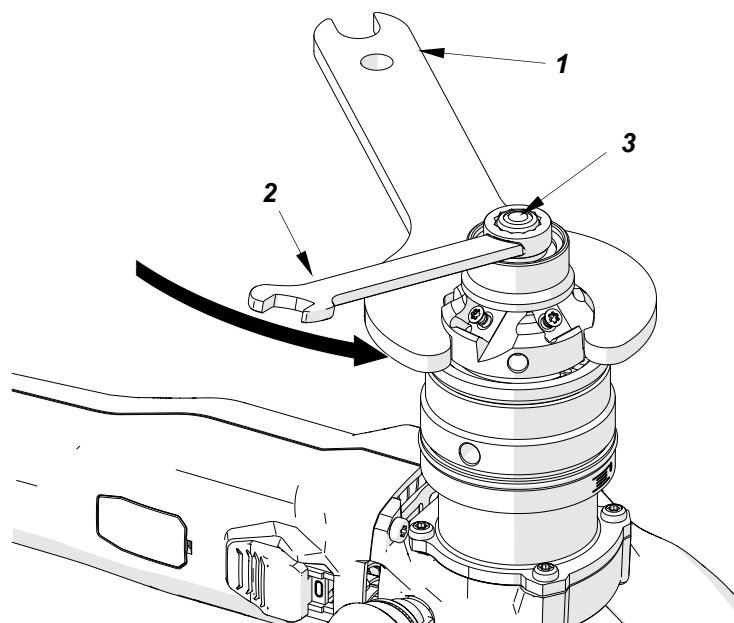


The drawing below shows the roller position for inserts R2-R4 and R5.

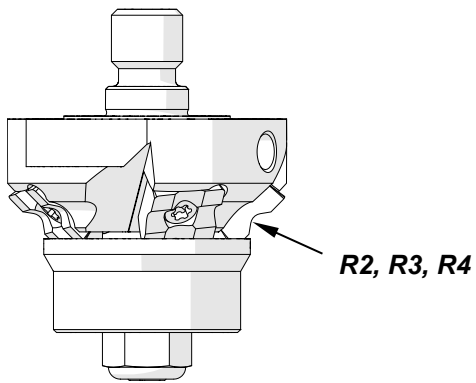

**INSTALLATION OF ROLLER
WITH INSERTS FOR CURVING**

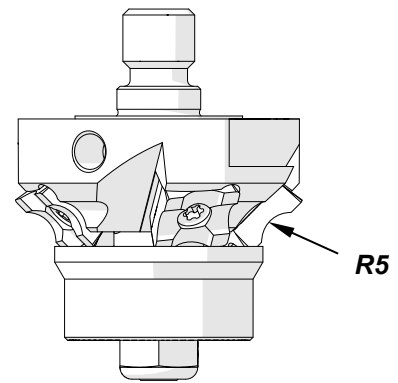

**INSTALLATION OF ROLLER
WITH INSERTS FOR CURVING**

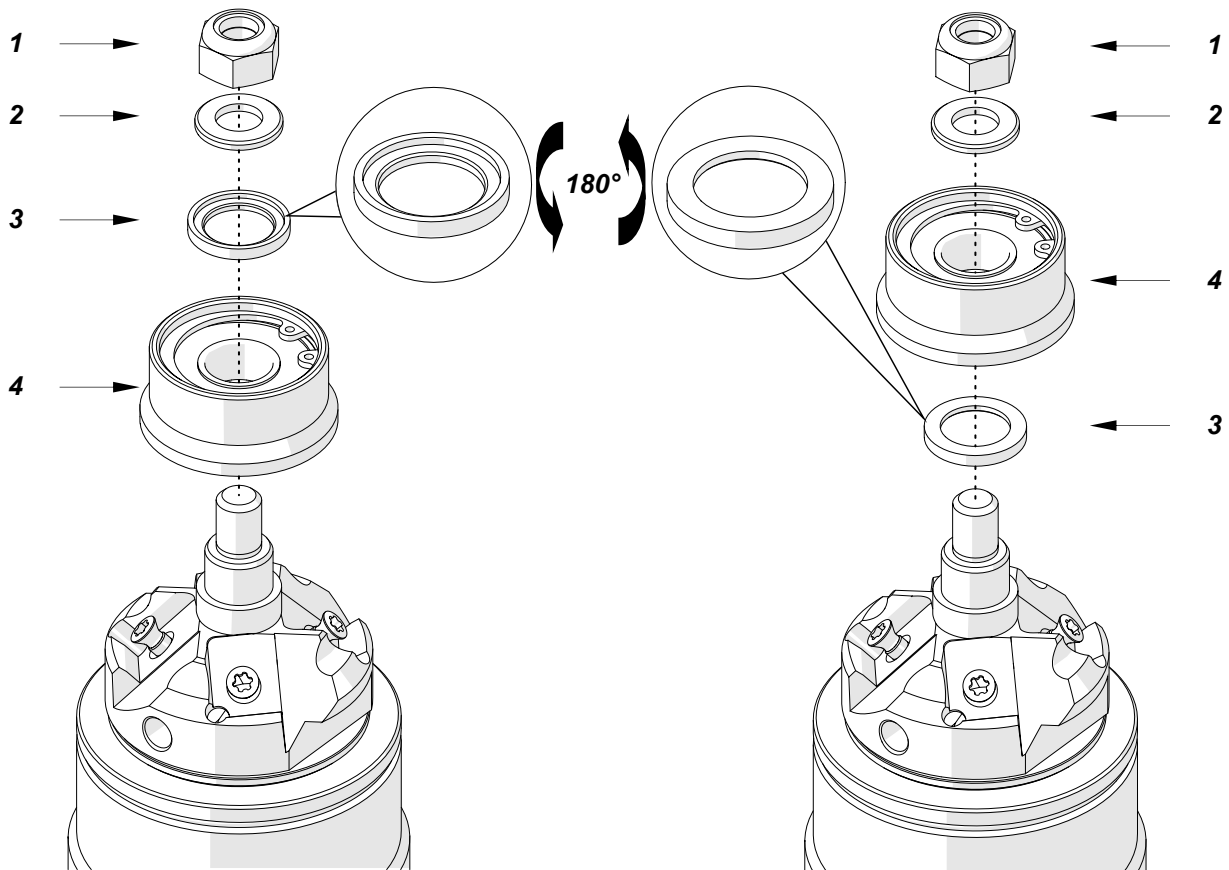

After unscrewing the nut (1), remove parts in the following sequence: round washer (2), special washer (3), roller with bearing and Seeger ring (4).


Rotate the special washer (3) so its shoulder is positioned downwards, towards the machine.

Reinstall parts in the following sequence: special washer (3), roller with bearing and Seeger ring (4), round washer (2), nut (1).

After reinstallation check if the roller rotates freely, without rubbing against the inserts.

4.9. Operation

Install the correct milling head with cutting inserts, and set the required bevel width. Put the machine on the left as shown in the figure. Make sure that the workpiece is stable.

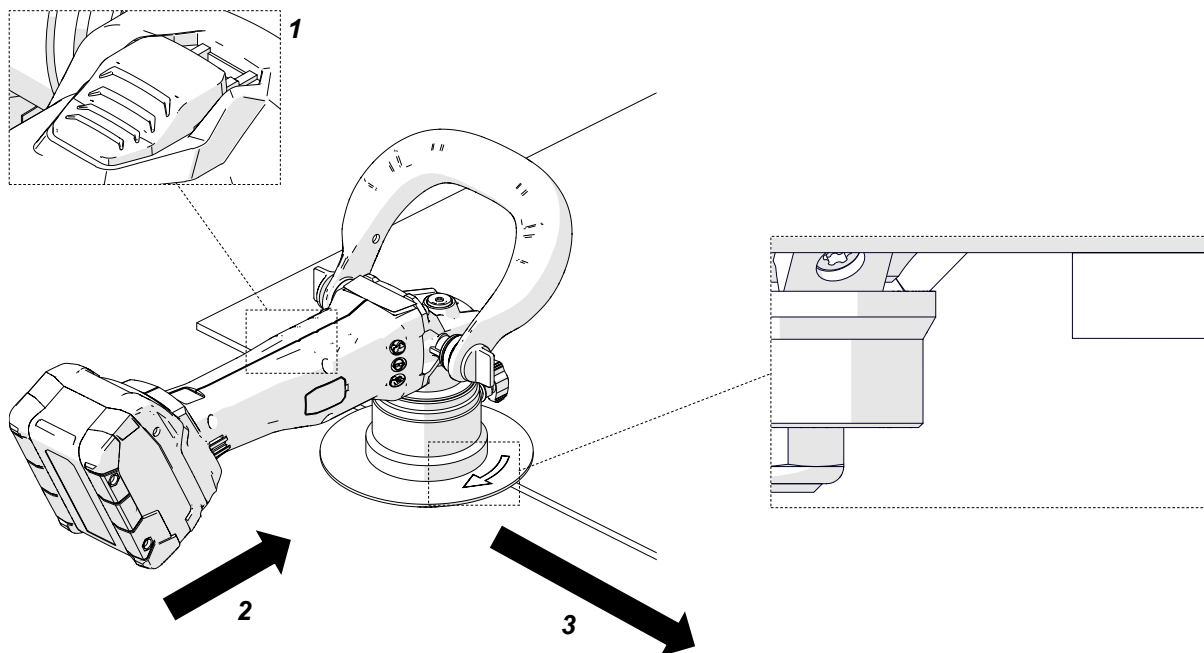

To start the motor, move the slide switch (1) forward. Wait a few seconds until the machine reaches the maximum speed. Use both hands to press the machine to the workpiece. Then slowly move the machine to the edge (2) until the tool starts cutting. Move the machine from left to right (3).

Bevel in two passes. Set the bevel width to a value that will allow the feed of 1 m/min (3 ft/min) without using too much force.

Remove maximum 4 mm (5/32") of material during one milling operation. Bigger bevels should be made in several milling operations. Do not exceed the maximum allowed bevel height (see technical data).

Perform test milling.

Maintain special caution during work. The beveling machine is susceptible to strong vibrations and kickback.

Kickback is a sudden reaction caused by catching or locking of rotating tool. Catching or locking causes the work tool to stop abruptly. As a result, the uncontrolled power tool gains acceleration in the direction opposite to the direction of rotation of the locked work tool.

If the milling head becomes jammed or blocked in the workpiece, the blocked edge of the cutting insert, when recessed into the workpiece, may cause it to break off or eject. The machine then moves in the direction of the operator or opposite direction, depending on the direction of rotation of the blocked insert. In such case the insert may also break.

Kickback is a consequence of incorrect or improper use of the power tool. By taking the appropriate precautions described below, one can prevent this from happening.

- a) Hold the machine firmly and keep your body and arms in a position to absorb the kickback force. By following the suitable safety measures the operator may control the kickback force.
- b) Maintain special caution when working in the area of corners, sharp edges, etc. Avoid situations in which the head jumps off the workpiece or becomes jammed. The rotating head easily becomes jammed in the workpiece in corners, on sharp edges, or in case of impact. It causes loss of control or kickback.
- c) Always insert the cutting head into the workpiece in the same direction in which the cutting edge exits the workpiece (the same direction the chips are ejected). Incorrect direction causes the cutting edge to break away from the workpiece, leading to the machine to be pulled in the direction of travel.
- d) Avoid locking the head or applying too much pressure. Do not set the bevel height above the maximum allowable value. Overloading the inserts increases

their stress and susceptibility to jamming or locking, and thus the possibility of kickback or breaking.

e) Avoid touching the area around the rotating head with your hands.

Rotate or replace dull cutting inserts and those with worn coatings in a timely manner.

Dull cutting inserts increase risk of jamming and breaking.

If there are vibrations in the machine or if the cutting inserts are dull or damaged, stop the machine and remove the battery. Then, rotate the inserts by 90° to change the cutting edges. If all cutting edges are worn, replace the inserts with new ones.

Replace inserts before they become dull to prevent overloading. Take periodic breaks during work. This prevents motor overheating and damage to the windings.


After the work is finished, release the power switch to turn off the motor.

Clean the machine with a dry cotton cloth and no chemical agents.

4.10. Replacing the brushes

Check the condition of the brushes every 100 work hours. To do this, remove the cover (1). Then loosen the screw (2), lift the spring (3), and remove the brush (4). If the brush is shorter than 5 mm (0.2"), replace both brushes with new ones.

Perform assembly in the opposite sequence. Make sure to put the terminal of the brush wire between the washer and the terminal of the motor wire. Then let the motor operate with no load for 20 minutes.

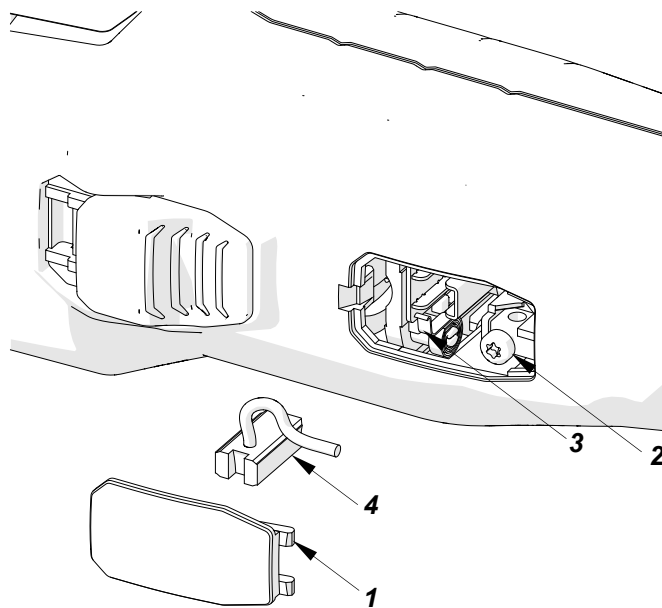


5. ACCESSORIES


5.1. Radius insert positioner

Allows you to set the guide correctly for rounding edges with a radius of 2, 3, 4, or 5 mm (5/64, 7/64, 5/32, or 3/16").

Part number:
UST-0509-16-00-00-0

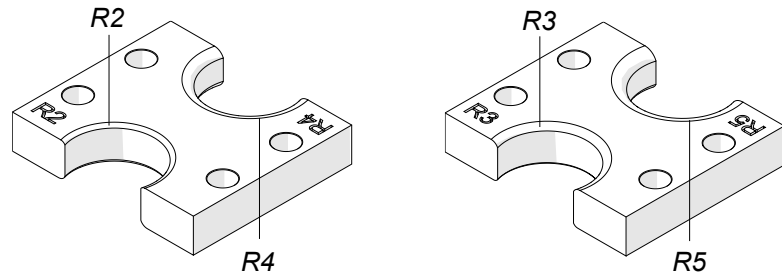


Lower the sleeve to get access to the cutting inserts. Put the positioner from the top (1) so that the edge marked with a given radius aligns with the edges of three cutting inserts of the same radius (2). Turn the sleeve (3) until the guide touches the positioner (4).

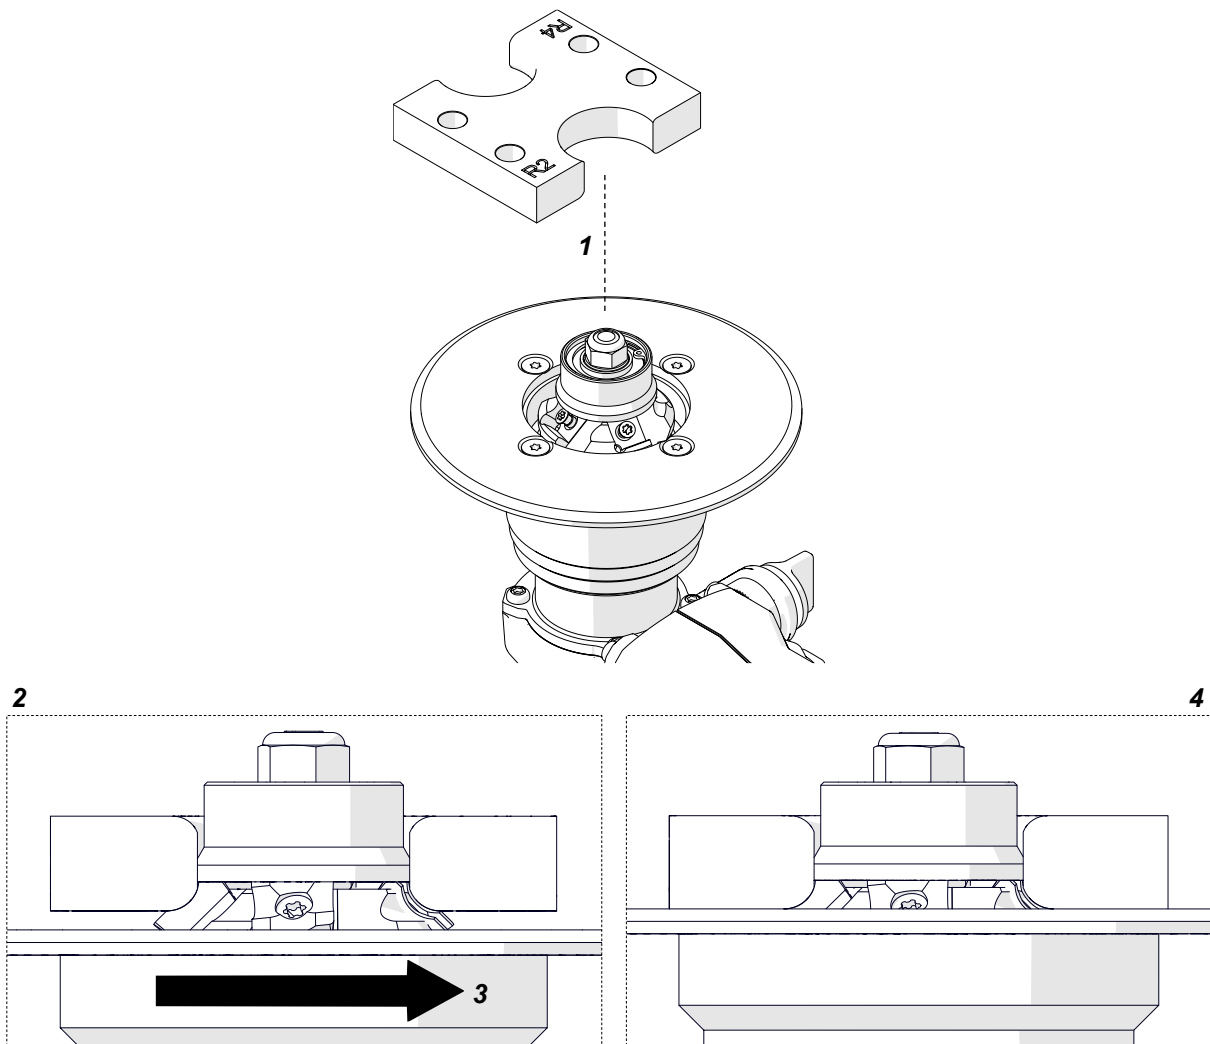

5.2. Guide sticker

The self-adhesive guide sticker protects aluminum workpieces from scratches. After you remove the sticker, clean the guide with petroleum ether.

Part number:
NKL-0540-15-00-00-0

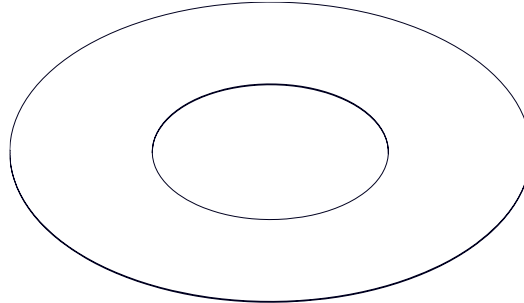


5.3. Milling tools

Part number	Part name
GLW-0540-09-00-00-0	30° milling head (with Ø35 mm roller and mounting screws for inserts; 4 cutting inserts required)
PLY-000391	Cutting insert for steel (sold 10 per set); for GLW-0540-08-00-00-0 and GLW-0540-09-00-00-0
PLY-000423	Cutting insert for aluminum (sold 10 per set); for GLW-0540-08-00-00-0 and GLW-0540-09-00-00-0
PLY-000737	Cutting insert R2 (sold 10 per set); only for GLW-0540-08-00-00-0
PLY-000738	Cutting insert R3 (sold 10 per set); only for GLW-0540-08-00-00-0
PLY-000739	Cutting insert R4 (sold 10 per set); only for GLW-0540-08-00-00-0
PLY-000740	Cutting insert R5 (sold 10 per set); only for GLW-0540-08-00-00-0

6. PARTS LIST

Part number	Part name
GLW-0540-08-00-00-0	45° milling head (with Ø35 mm roller and mounting screws for inserts; 4 cutting inserts required)
RLK-0540-08-02-00-0	Ø35 mm roller for GLW-0540-08-00-00-0 and GLW-0540-09-00-00-0
SRB-000289	Mounting screw for insert for GLW-0540-08-00-00-0 and GLW-0540-09-00-00-0
WKT-000005	T15P screwdriver for mounting screws
SMR-000005	Grease for mounting screws (5 g, 0.17 oz)
SCZ-000038	Carbon brush

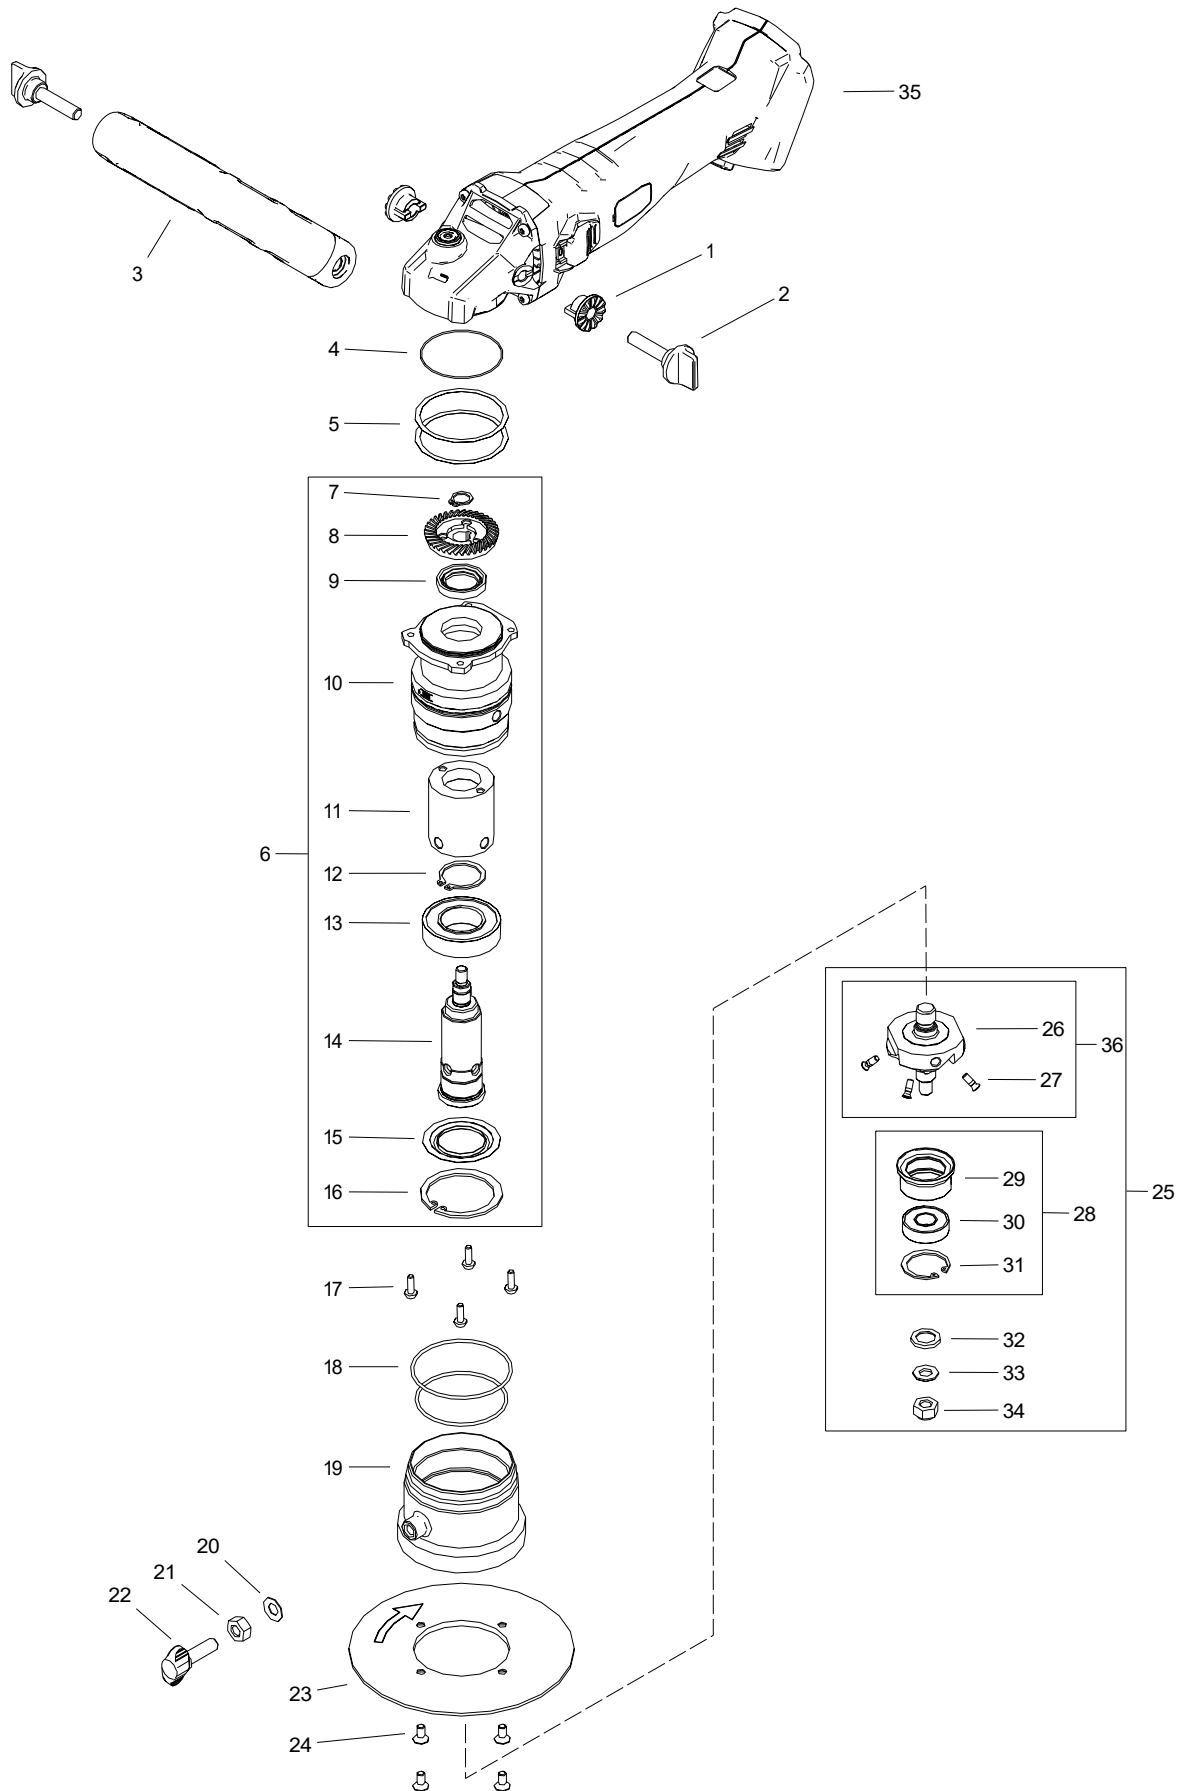

ITEM	PART NUMBER	DESCRIPTION	Q-TY
1	PDK-000334	SLOTTED DISC	2
2	PKT-000066	KNOB	2
3	UCW-000378	HANDLE	1
4	PRS-000430	SEAL RING	1
5	PDK-000327	DISTANCE WASHER	2
6	ZSP-0763-01-00-00-0	SPINDLE ASSY	1
7	PRS-000160	EXTERNAL RETAINING RING 11z	1
8	KOL-0763-01-03-00-0	GEAR	1
9	PRS-000431	SEAL RING 20x30x5	1
10	TLJ-0763-01-02-00-0	SLEEVE	1
11	TLJ-0763-01-04-00-0	MASS SLEEVE	1
12	PRS-000017	EXTERNAL RETAINING RING 25z	1
13	LOZ-000248	BALL BEARING 25x47x12	1
14	WRZ-0763-01-01-00-0	SPINDLE	1
15	PRS-000445	SEAL RING 29x47x2.5	1
16	PRS-000030	INTERNAL RETAINING RING 47w	1
17	WKR-000603	TORX SELF-TAPPING SCREW M4x12	4
18	PRS-000337	SEAL RING 52x2	2
19	TLJ-0763-02-00-00-0	ADJUSTING SLEEVE ASSY	1
20	SPR-000012	DISC SPRING 8.2x16x0.6	1
21	NKR-000019	HEX NUT M8	1
22	PKT-000055	MINIWING KNOB	1
23	TRC-0540-04-00-00-0	GUIDE	1
24	WKR-000538	TORX COUNTERSUNK HEAD SCREW M5x10	4
25	GLW-0540-08-00-00-0	HEAD ASSY	1
26	KRP-0540-08-01-00-0	MILLING HEAD BODY	1
27	SRB-000289	FIXING SCREW FOR RADIUS INSERT	4
28	RLK-0540-08-02-00-0	ROLLER ASSY	1
29	RLK-0540-08-02-01-0	ROLLER	1
30	LOZ-000038	BALL BEARING 12x28x8	1
31	PRS-000018	INTERNAL RETAINING RING 28w	1
32	PDK-0540-08-03-00-0	SPECIAL WASHER	1
33	PDK-000202	SMALL ROUND WASHER 8.4	1
34	NKR-000038	HEX NUT M8 WITH POLYAMID INSERT	1
35	NPD-000073	MOTOR ASSY	1
36	KRP-0540-99-01-00-0	RADIUS MILLING HEAD BODY ASSY	1